
Simplified Adjustments (Z Axis Medium Load Capacity)

For Frequent Setups / For Infrequent Setups

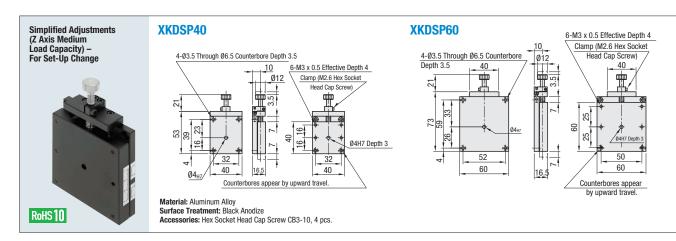


Part Number		Stage	Travel Distance	Load Capacity	Weight	
Туре	No.	(mm)	(mm)	(N)	(g)	
VVDCD	40	40 x 40	±6	19.6	100	
XKDSP	60	60 x 60		39.2	190	


1.5mm Minimum Graduation: 0.5 mm

1 The allowable loads are for using in Z-Axis configuration (in the orientation shown in the photo).





O Not recommended for precise positioning due to its clearance shown on the left

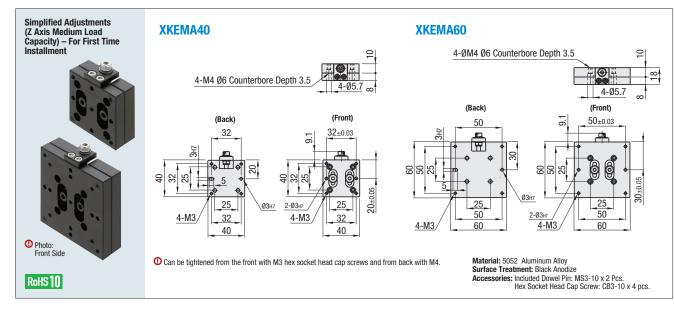


Part Number		Stage Surface	Travel Distance	Load Capacity	Weight		
	Туре	No.	(mm)	(mm)	(N)	(g)	
	XKEMA	40	40 x 40	±3	49	70	
AKEIVIA	60	60 x 60	±5	98	160		

The allowable loads are for using in Z-Axis configuration (in the orientation shown in the photo).




1996

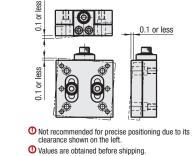

Simplified Adjustments (XY Axes Feed Screw)

Standard Type – Standard & Large Handle

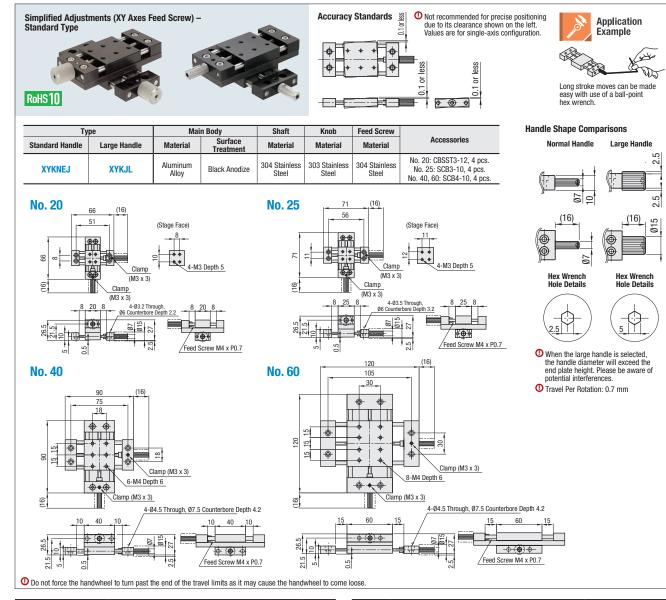

Part Number			Stage Surface	Travel Distance	Load	Weight
Туре	No.	Large Handle Selected	(mm)	(mm)	Capacity (N)	(kg)
	20	Large Handle Top & Bottom L Large Handle Top Only A Large Handle Bottom Only B	20 x 20	±7	18.6	0.10
Standard Handle XYKNEJ	25		25 x 25			0.13
Large Handle XYKJL	40		40 x 40	±9	36.2	0.27
ATROL	60		60 x 60	±13	36.2	0.48

① Travel per Rotation: 0.7mm



Part Number






Part Number

Part Number

XYKNEJ40

XXK'II BUI

XYKJL40A XYKNEJ60

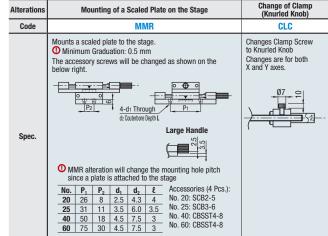

Accuracy Standards