
## [Simplified Adjustments] X-Axis, Feed Screw, Side Clamp Units / Key Guide Units


Feature: Strong side clamp enables desirable mounting of workpieces. Spring Washer Integrated Screws are applied for clamp providing preload.

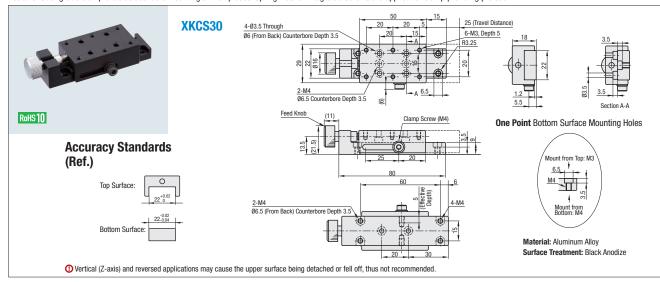

Part Number		Stage Surface	Travel Distance	Travel per Rotation	Load Capacity	Weight	<b>Q</b>	Application Example	Position Adjustm	
Туре	No.	(mm) (mm)		(mm)	(N)	(kg)	Marin Col			
XKCS	30	29 x 50	25	0.8	9.8	0.1			XKYFB40	

Part Number Example Part Number XKCS30

Feature: Simplified Adjustment Units utilizing key guides (convex surface). Screw mounting enables strong clamp, and a scale label is included

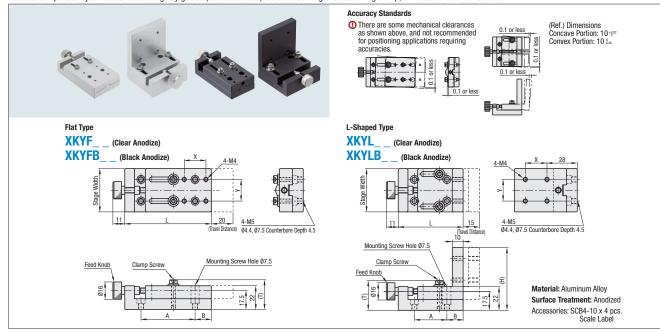

Part Number				Travel	Travel per									Load	
Туре		No.	Stage Width	Distance	Rotation	Α	В	Н	L	T	Х	Υ	Clamp Screw	Capacity	Weight (kg)
Clear Anodize	Black Anodize	NO.	NO.	(mm)	(mm)									(N)	( 3/
VVVE	ХКҮГВ	40	40	20	- 0.8	50	15	_	80	(27.5)	20	20	M4	19.6	0.18
XKYF		60	60			60	25	_	100	(29)	30	30	M5	39.2	0.34
XKYL	XKYLB	40	40	15		30	15	58	60	(27.5)	20	20	M4	9.8	0.18
AKYL		60	60					73		(29)	30	30	M5	19.6	0.28


There's more on the web: misumiusa.com




Part Number
XKYF40
XKYLB60

## MiSUMi

## [Simplified Adjustments] X-Axis, Left/Right Screw, Open/Close Width Adjusting Units / Rack & Pinion, Standard, Standard/Precision Grade

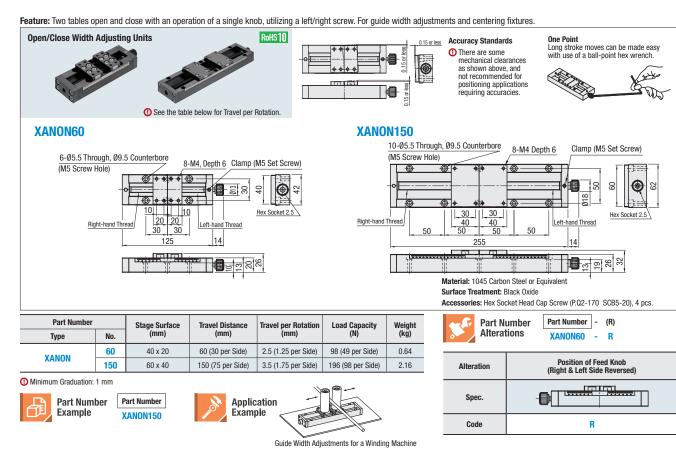

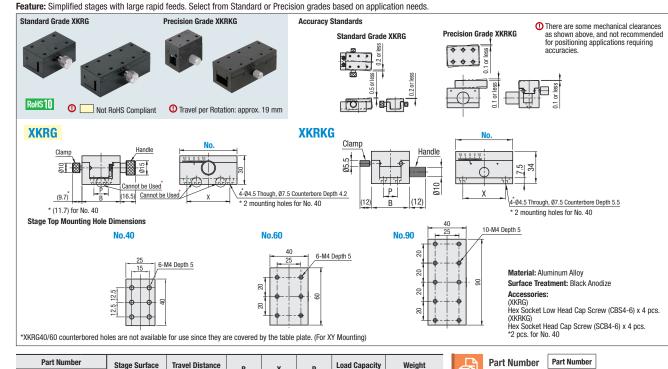

29.4

39.2

0.10

0.21

0.30

① Travel per Rotation: Approx. 19 mm ① Minimum Graduation: 0.5 mm

25 x 40

40 x 60

40 x 90

No.

60

**XKRKG** 

25

31

45

±12

±14